

VPFlowScope DP

User manual © 2017 Van Putten Instruments BV



VPFlowScope DP

© 2017 Van Putten Instruments BV

All rights reserved. No parts of this document may be reproduced in any form or by any means - graphic, electronic, or mechanical, including photocopying, recording, taping, or information storage and retrieval systems - without the written permission of the publisher.

Products that are referred to in this document may be either trademarks and/or registered trademarks of the respective owners. The publisher and the author make no claim to these trademarks.

While every precaution has been taken in the preparation of this document, the publisher and the author assume no responsibility for errors or omissions, or for damages resulting from the use of information contained in this document or from the use of programs and source code that may accompany it. In no event shall the publisher and the author be liable for any loss of profit or any other commercial damage caused or alleged to have been caused directly or indirectly by this document.

Creation date: 19-01-2017 in Delft

Publisher

Van Putten Instruments BV Buitenwatersloot 335 2614 GS Delft The Netherlands

This document is available in: English, English (UK)

Table of Contents

Warning - Read	d this first	5
Introduction		6
Configuration VPFlowScope DP with co	onnector capsplay	
•		9
Flow Pressure Temperature		
Piping table	stallation	
Display status icons LCD display Data Logger Keypad		
VPStudio softv	vare	22
Electrical conr	nections	23
Pulse output		2
Service		30
Recalibration Filter set replacement		
	Introduction Product overv Configuration VPFlowScope DP with co VPFlowScope DP with di VPFlowScope DP with the Quick start Measurement Flow Pressure Temperature Totalizer Mechanical inst Piping table Flow range table Display Display status icons LCD display Data Logger Keypad Menu VPStudio soft Electrical conr 420mA output Pulse output Modbus interface Service Software and firmware up Recalibration	Product overview Configuration VPFlowScope DP with connector cap

11 Specifications	32
12 Order information and accessories	33
13 Appendix A - Ul	34

1 Warning - Read this first



Compressed gasses can be dangerous! Please familiarize yourself with the forces under pressurized conditions. Respect the local guidelines and regulations for working with pressurized equipment.



Gas flow through pipes follows certain physical laws. These physical laws have serious consequences for the installation requirements. Familiarize yourself with these laws to make sure that the product is installed correctly. Always make sure that upstream length, downstream length, flow, pressure, temperature and humidity conditions are within specifications.



Precision instruments need maintenance. Check your flow meter regularly and make sure it remains clean. When polluted, gently clean the sensor using demineralised water or cleaning alcohol. Check the internal filters and clean them when polluted or damaged.

Precision instruments need regular re-calibration. To keep your VPFlowScope DP in best shape, it needs recalibration. We advice annual recalibration.



Not intended for fiscal metering or billing. Our flow meters are not certified for fiscal metering. Laws on fiscal metering and billing may vary per country or state.



Do not overestimate the results. VPInstruments does not take any responsibility for the correctness of measurement results under field conditions. The practical measurement uncertainty of a flow meter in the field may vary, depending on how well it is installed, due to the nature of gas flow. The piping table provides guidelines on how to optimize the field accuracy. Our products are not intended to be used as a single means to determine compressor capacity.



Do not open the device. Our instruments are assembled with high precision. Opening this device is dangerous and may destroy the instruments. Warranty is voided when you open the instrument.



Feedback leads to product improvement. Please share your experience with us, as we are continuously improving our products in our commitment to quality, reliability and ease of use. Let us know via sales@ypinstruments.com!



The VPFlowScope DP is designed for use in wet air applications. It can handle 100% saturated air, where condensation may occur from time to time. However, the VPFlowScope DP is NOT a water or multiphase flow meter. A too high water content which causes flooding of the compressed air network with liquid water will cause misreadings and may damage the instrument.

Stabilization time: When exposed to large pressure changes, for example during installation of the sensor, the DP sensor element needs to stabilize. This takes up to 15 minutes. During this time, readings may have a larger error.

2 Introduction

Congratulations! You purchased the easiest to use and most complete compressed air measurement tool in the world. With the VPFlowScope DP, you can monitor and record flow, pressure, temperature, and total air consumption, simultaneously.

Great products deserve great user manuals. We have done our best to make this user manual as complete as possible. New users, please read it carefully to familiarize yourself with our products. Experienced users can check out the Quick start chapter.

Check the packaging box for any inconsistencies. Should there be any shipping damage, notify the local carrier. At the same time a report should be submitted to Van Putten Instruments BV, Buitenwatersloot 335, 2614 GS DELFT, The Netherlands.

This manual is dedicated to:

VPS.R200.P4DP (VPFlowScope DP)


VPStudio software version 1.24 Sensor firmware version 1.20.10 Display firmware version 2.9.0

Older software features may not be covered by the contents of this user manual. Please contact us for a service subscription program, which includes software and firmware updates!

3 Product overview

The VPFlowScope DP measures mass flow, temperature and pressure simultaneously. All these parameters are key to proper compressed gas measurement and are therefore included in all models. With the insertion probe you are flexible in pipe diameter. All data can be accessed by Modbus RTU, 4..20mA and pulse.

The VPFlowScope DP is available in three configurations to fit every application. Use the connector cap for sensor features only, ideal for integration into a central management system. Use the display module for central read out and data logging. Use the VPFlowTerminal for central read out and data logging on location where a standard display can not be read out. For all models, all parameters and outputs are available.

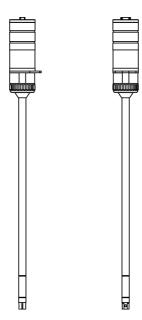

The VPFlowScope DP is available in 1 length (400 mm) only. You can choose some options:

		j (
Order Code	Flow range	Option	Length	Option	Display
VPS.R200.P4DP	20 to 200 mn/sec	P400	400 mm length	D0	No display, No connector cap
				D10	Display
				D11	Display + 2M point logger
				D2	Connector cap


Order the VPFlowScope KIT to receive the complete start kit with all required accessories, everything you need to get started right away.

3.1 Configuration

The instrument needs only one step to be ready for operation. It needs to know the exact inner pipe diameter for accurate measurement, wrong inner diameter will lead to very significant errors. The pipe diameter can be programmed with the keypad on the display module or with the VPStudio configuration software. This software suite is also used for configuration of the outputs and data logger. This software can be downloaded from our website. www.vpinstruments.com/downloads.


3.2 VPFlowScope DP with connector cap

The VPFlowScope DP with connector cap can be used in applications where local read-out and data logging is not required. With it's various outputs the VPFlowScope DP can be connected to remote data loggers.

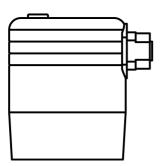

3.3 VPFlowScope DP with display


The display module adds a 3 row display with keypad and a 2 Million point data logger(optional) to the VPFlowScope DP. All parameters will be shown on the display in real time. The keypad can be used to start a data log session or to change the key parameters of the VPFlowScope DP. All output parameters for remote connection remain available on the M12 connector.

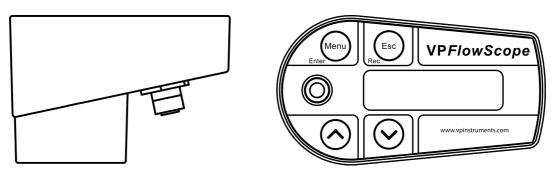

3.4 VPFlowScope DP with the VPFlowTerminal

The VPFlowTerminal can be used as a remote display for situations where the local display can't be read. All display features will be available on the remote display.

The VPFlowTerminal is equipped with a 10 m / 32.8 ft. cable and connector cap with a M12 8pin connector. The standard connector cap with M12 5pin connector can not be used for connection with the VPFlowTerminal. The VPFlowTerminal features a 2 Million point data logger which extends the data log capacity of your VPFlowScope DP.

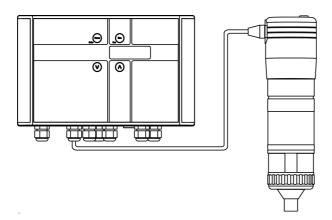

4 Quick start

This chapter contains the basic steps to start using your VPFlowScope DP flow meter. Additional information on all subjects can be found in the next chapters.

1. Unpack

Unpack the meter and check if all items are there and in good shape. A checklist with all items is available on the box.

2. Program the settings

- The inner pipe diameter needs to be programmed into the sensor. This can be done via the display or with the VPStudio software. (www.vpinstruments.com/downloads)
- If required, set the output parameters for the Modbus, pulse and current output.

3. Mechanical installation

- Find the best point of installation for this product. Make sure that all specifications are met.
- For installation of the VPFlowScope DP, an insertion point needs to be created. You can weld a tap with minimum internal 1/2 inch thread or use a hot tap saddle.
- Place a ball valve (minimal 1/2 inch full bore) and compression fitting on the insertion point.
- Connect the safety cable and insert the probe into the pipe.
- The sensor needs to be in the middle of the pipe.
- Tighten the compression fitting.

See chapter <u>mechanical installation</u> for more detailed information.

3. Electrical installation

3.1 Permanent installation

Connect a cable with 5 Pin M12 connector to the VPFlowScope DP. Use the power supply module for permanent installation. The cable can also be connected to a central data acquisition / building management system or data logger via Modbus, 4..20mA or pulse. See chapter electrical connections for more information.

Apply 12-24 VDC to power up the device. Use a Class II power supply (less than 2 Amps). If a display is available, it will light up when power is applied.

3.2 Temporary installation

Use a 12-24VDC power supply with M12 connector to power the VPFlowScope DP. This quick method is ideal for audits.

4. Data recording

When the data logger option is available a data log session can be started by pressing the esc button and then enter. All parameters will be logged with the default logging intervals. These logging intervals can be changed with the VPStudio software. This software tool is also used to retrieve the recorded sessions.


5 Measurement

For all parameters the update interval is 1 second. Within this second, multiple samples are taken and averaged to provide a stable and reliable output.

5.1 Flow

The VPFlowScope DP uses the differential pressure principle.

In the picture on the right, the principle is explained. Flow will create a differential pressure over the probe. This pressure is measured by the differential pressure sensor element. The gauge pressure is also measured by a separate gauge pressure sensor. The temperature sensor will measure the gas temperature. The three sensors combined provide a mass flow output.

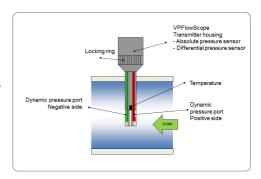

5.2 Pressure

The VPFlowScope DP features a built-in gauge pressure sensor. The sensor range is 0..16 bar | 0...250 psi gauge.

The sensor signal is sampled with 16 bits. The practical resolution is 0.24 mbar on the 0..16 bar scale, which is equal to 0.004 psi on the 250 psi scale

5.3 Temperature

The built in temperature sensor measures the compressed air/ gas temperature. It is mounted in a separate position, to ensure quick response time and low self-heating of the sensor element. The signal is sampled with 16 bits. The resolution is less than 0.1 °C.

In a vertical pipe, with flow going down, the temperature sensor may heat up at zero flow conditions, due to the heated flow sensor element. This effect will disappear as soon as there is consumption.

For optimal measurement performance, the VPFlowScope DP needs to be in a stable temperature environment. When exposed to quick temperature changes or large temperature changes (for example taking the unit from outdoor to indoor during winter time, or when mounted downstream of a heat regenerated drier) the temperature compensation may lag behind, which may result in significant measurement errors.

5.4 Totalizer

The totalizer keeps track of the total consumed amount of compressed air in normal cubic meters, or in scf depending on which unit you choose to read out. The refresh interval is 1 second, actual measurement data will be available on the display and by Modbus. For back up reasons, the totalizer value is written to it's internal memory with an interval of 15 minutes. A power down might result in maximum 15 minutes of totalizer data loss.

In bi-directional operation, negative flow is subtracted from the totalizer. The totalizer will count backwards as the compressed air is delivered back to the supply side. The totalizer can only be reset to zero. It's not possible to set it to a different value.

The display will show totalizer values up to 999.999,9 and will then become 0,0 independent of the taken unit. This will not clear the internal totalizer.

6 Mechanical installation

Put together the VPFlowScope DP

Connect the display or connector cap on the VPFlowScope DP sensor module. Make sure that it slides completely over the O-ring seal. Position the O-ring in the upper position for the connector cap. Use the lower position for the display. Apply some O-ring grease if required. Gently fix the screw on top.

Install the VPFlowScope DP in the pipe

First select the right installation point. The installation point is crucial for the right measurements. Sources of error can be: installation effects, unknown flow profiles, swirls, pressure and temperature effects, humidity effects, oscillations in the flow. To ensure the highest possible accuracy of flow measurement, the installation and piping instructions must be followed carefully. Therefore read this paragraph carefully.

Take into account:

- Choose a site which is accessible, which allows ease of wiring and maintenance, and which allows you to still read and access the display if possible.
- Meet the specifications of the VPFlowScope DP. When the specifications are not met, for instance
 the pressure or temperature level is too high; this will cause inaccurate flow measurement and can
 even damage your flow meter.
- · Do not apply mechanical stress.

Avoid:

- Excessive heat, check the temperature range of your VPFlowScope DP.
- Potential water damage on the outside. Avoid areas of high humidity and avoid dripping. Be aware that the VPFlowScope DP is not watertight, it is only splash proof.
- Corrosive atmosphere where possible.
- Electrical problems (high voltage/ high power).
- Mechanical vibration and danger (walking bridges, fork lift trucks).



Stop: These devices are only for use with Compressed air, non aggressive gasses and non combustible gasses. The maximum working pressure is 16 bar (250 psi)

Prepare the installation

The VPFlowScope DP can be inserted through a welding tap with internal 1/2 inch thread or through a hot tap saddle. A hot tap saddle can be installed under pressurized conditions, so there is no need to shut down production.

Use a ball valve to insert and retract the VPFlowScope DP when you want. Use a 1/2 inch full bore ball valve or a 3/4 inch ball valve. The VPInstruments hot tap drill has a 1" drill size. In that case, place a 1" ball valve and use, after drilling, a reducer to go back to 1/2" for the compression fitting.




Warning: Make sure that the hole is at least 16 mm | 0.63 inch, and completely clear for insertion. A too small hole will damage the probe or can block the probe when the entering the pipe.

The installation


Insertion depth

 Generally the insertion depth of the VPFlowScope DP is 0.5 times the inner pipe diameter, where the bottom of the sensor tip must be in the middle of the pipe (see picture).



Position


Install the VPFlowScope probe upwards in an angle between 1 and 2 o'clock (see picture). Never install the instruments upside down.

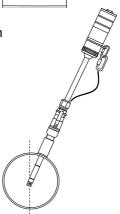

The VPFlowScope DP is shaped to make alignment with the flow direction easy. Alignment "by the eye" is sufficient.

Exception

Between pipe sizes of 25 mm and 55 mm | 1 inch and 2 inch: be aware that the field accuracy is +/- 10%; installation errors are bigger. The insertion depth between 25 mm and 65 mm | 1 inch and 2.5 inch is also different. The VPFlowScope DP needs to installed 5 mm | 0.2 inch from the bottom or else the temperature sensor of the VPFlowScope DP itself is outside the flow path. The sensor tip will not be in the middle of the pipe any more. The measurement value is automatically corrected for small diameters.

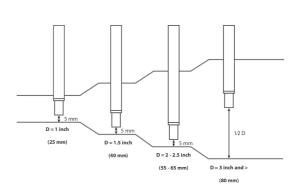


STOP

SAFETY FIRST: START WITH MOUNTING THE SAFETY LINE!


The VPFlowScope probe is mounted with a 1/2 inch compression fitting. The probe is sealed with a Teflon ferrule instead of a stainless steel ferrule. Teflon may become slippery. The safety line will keep the sensor secure when it accidentally moves out of the compression fitting. NEVER over-tight the fitting, because it might damage the sensor tube.

Installation with standard safety line

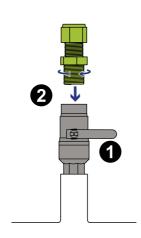




- 1. Keep the ball valve closed!
- 2. Insert the compression fitting in ball valve. Use remains in the compression fitting. Teflon tape or liquid sealant.

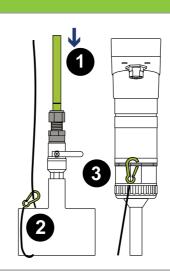


Step 2.

- 1. Insert the VPFlowScope DP. The probe
- 2. Attach the safety line to the pipe.
- 3. Hook the safety line to the ring of the VPFlowScope DP.

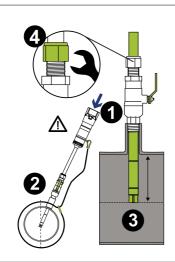

Step 3.


- 1. Keep your hand on top of the VPFlowScope DP.
- ⚠ When you install the VPFlowScope DP into a pressurized system you are about to experience temporary leakage and force trying to push out the VPFlowScope DP from the compression fitting. When the safety system is correctly installed this is part of the normal installation procedure.
- 2. Open the ball valve slowly and push the VPFlowScope DP gently downwards.
- 3. The probe tip should be in the centre of the pipe
- 4. Tighten the compression fitting

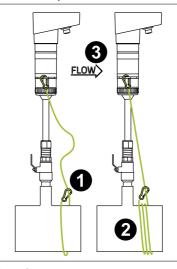


Step 4.


Optionally pull tight the safety line. When adjusting the safety line, make sure you secure the VPFlowScope DP otherwise during adjustment. This can fox example be done by applying force by hand on top of the instruments or with a secondary safety line

- 1. Unlock the safety line
- 2. Pull tight the safety line and lock the safety line again
- 3. Align the flow direction. Alignment by the eye is sufficient

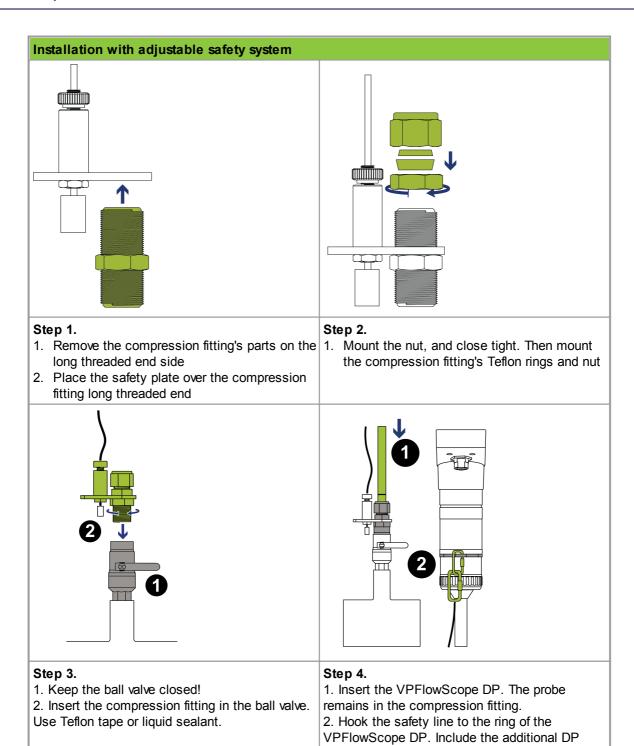

hook.

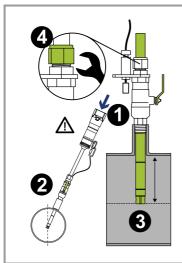

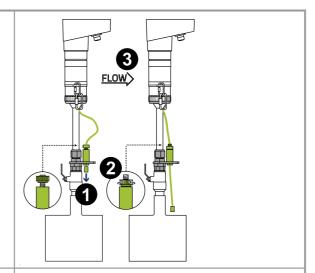

Step 5.

1. Keep your hand on top of the VPFlowScope DP

When you install the VPFlowScope DP into a pressurized system you are about to experience temporary leakage and force trying to push out the VPFlowScope DP from the compression fitting. When the safety system is correctly installed this is part of the normal installation procedure.

- 2. Open the ball valve slowly and push the VPFlowScope DP gently downwards.
- 3. The probe tip should be in the centre of the pipe
- 4. Tighten the compression fitting

Step 6.

- 1. Unscrew the safety lock and pull the safety line tight
- 2. Tighten the safety lock
- 3. Align the flow direction. Alignment by the eye is sufficient

6.1 Piping table

Check the piping table below for your application. The table shows the amount of length upstream or downstream depending on the installation. If applicable in front of the meter, use given upstream length. If applicable in behind the meter, use given downstream length. Gas flow in pipes follows certain rules, which must be observed for optimal measurement results. For some exceptions the upstream length needs to be longer, or can be shorter.



If possible choose a longer upstream length, as these are minimum values. The up- and downstream lengths are used industry wide as guidelines, but will never be a guarantee for obtaining the "true value". So always be careful and try to build up your own experience from practical measurements

Piping table

The following table provides a guideline for proper distances between upstream or downstream objects and the VPFlowScope DP. The upstream length is the length between the last non-straight object and the VPFlowScope DP. If the upstream length is straight, and the distortion is downstream of the VPFlowScope DP, you can use the column "downstream length" as a guideline. In very complex situations, with multiple up- and downstream objects, you should consider another location. This table is a practical guideline and is not exact science. Practical situations can have multiple sources of distortion, therefore VPInstruments does not take any responsibility for the correctness.

Picture	Description	Upstream length ²	Downstream length ²	Effect
 	Single elbow	30 * D1	10 * D1	Distorted flow profile
	Complex feed-in situation (header)	40 * D1	10 * D1	Flow profile will be distorted
1	Double elbow, multiple elbows following each other	40 * D1	10 * D1	Distorted profile + swirl
	Diameter change from small to large (gradual or instant)	40 * D1	5 *D1	Jet shaped flow
-	Diameter change from large to small (gradual change, between 7 and 15 degrees)	10 * D1	5 * D1	Flattened flow profile

^{1 =} inner diameter; 2 = minimum length

6.2 Flow range table

	Schedule 40 standard seamless carbon steel pipe						
		II	D		Fl	ow	
Size (inch)	DN	Inch	mm	Min (scfm)	Max (scfm)	Min (m ³ _n /hr)	Max (m³ _n /hr)
2	50	2.1	52.5	2	688	4	1,169
3	80	3.1	77.9	5	1,516	9	2,576
4	100	4.0	102.3	9	2,610	15	4,435
6	150	6.1	154.1	20	5,924	34	10,065
8	200	8.0	202.7	34	10,259	58	17,429
10	250	10.2	259.1	56	16,756	95	28,468
12	300	11.9	303.2	77	22,953	130	38,995
16	400	15.0	381.0	121	36,237	205	61,565
20	500	18.8	477.8	190	56,996	323	96,832

The ranges apply only to compressed air and nitrogen

Schedule 10 standard seamless carbon steel pipe							
		l l	D		Fl	ow	
Size (inch)	DN	Inch	mm	Min scfm	Max scfm	Min m ³ _n /hr	Max m ³ _n /hr
2	50	2.2	54.8	2	749	4	1,273
3	80	3.3	82.8	6	1,712	10	2,908
4	100	4.3	108.2	10	2,923	17	4,966
6	150	6.4	161.5	22	6,508	37	11,057
8	200	8.3	211.6	37	11,173	63	18,982
10	250	10.4	264.7	58	17,487	99	29,709
12	300	12.4	314.7	82	24,724	140	42,004
16	400	15.6	396.8	131	39,315	223	66,794
20	500	19.6	496.9	205	61,643	349	104,729

The ranges apply only to compressed air and nitrogen

7 Display

The display provide some additional features:

- LCD display with 3 rows of real time data, refreshed every second
- Key pad with menu to configure the main settings
- Data logger with adjustable logging intervals (option)
- 5 custom units (multiply and existing unit with a factor and show it on the LCD display)

7.1 Display status icons

Some status icons show feedback on the meters' status. Below is a list with explanation

Icons	Description
异	Sensor module is properly connected to the display and supplied with power
+	No communication with the sensor [Check external power when disconnected]
	A blinking dot will indicate that a data session is active
{ }	2 rotating arrows indicate that there is communication with the computer
•	The display is locked. The menu can not be accessed
00000	Memory indication. Each block indicates 20% of memory usage. The blocks start to blink if the memory is more then 95% full

7.2 LCD display

The LCD display provides 3 rows for real time data. Each row can be configured in the menu by selecting the desired parameter for this row.

Available options are listed in menu -> display.

7.3 Data Logger

Use the following guidelines for the intervals


Application	Flow	Pressure	Temperature
Standard energy management application	5 min	5 min	5 min
Machine testing - quick fluctuations	1 sec	1 sec	1 sec
Audit - one week	10 sec	10 sec	5 min
Audit - one month	30 sec	30 sec	5 min

Multiple sessions can be recorded. When a session is started, a separate session will be recorded. It's not possible to append to an existing session.

When a power failure occurs during recording, the session will be stopped. When power is restored, a new session will start automatically.

7.4 Keypad

The key pad contains 4 buttons to control the display.

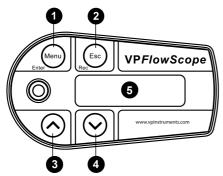

- 1 Menu / Enter Used to enter the (sub)menu or to confirm a setting
- 2 Escape / Record Will start a data logging session when in the data acquisition screen.

Will return from a (sub)menu when not in the data acquisition screen

3 Button up4 Button downNavigate up in the menuNavigate down in the menu

Special key functions

Lock display

In the main screen, press up and down simultaneously to lock or unlock the display. A lock icon will appear in the right lower corner of the screen. The lock function will block keypad functionality.

· Clean re-boot.

Hold esc pressed when turning the power on. Use this option when a display will not start up or if a session won't stop. This can happen due to subsequent power failures at the moment that the memory is almost full.

7.5 Menu

The menu is categorized into 3 main items which contain their own sub menu items. The complete menu structure is shown below:

- 1. Settings
 - 1. Diameter
 - 2. Display
 - 3. Date and Time
 - 4. Modbus address
 - 5. Display dimtime
 - 6. Display orientation
- 2. DAQ Sessions
 - 1. New Session
 - 2. Delete all
- 3. Advanced
 - 1. Reset

1 Settings

The settings menu can be used to change both functional parameters as display settings.

1.1 Diameter

The sensor needs to know the exact inner pipe diameter to calculate mass flow. Changing the diameter is only possible when the sensor is connected. When the menu is entered, first select the desired unit, this can be in mm or inch.

Now enter the inner pipe diameter en confirm by pressing enter.

1.2 Display

The main screen of the display contains 3 rows to display measurement values. Via this menu measurement values can be assigned to these rows. Available options in the menu are:

Measurand	Available units	Description
Empty	-	Leave this display row empty
Flow	m _n /sec	Normalized
	m ³ _n /h	
	I _n /min	
	SCFM	
	m ³ _n /min	
	sfps	
Pressure	bar	Gauge
	psi	
Temperature	°C	
	°F	
Totalizer	m ³ _n	Normalized
Custom		5 available units to be configured with VPStudio. Multiply an existing unit with a user defined factor.

1.3 Date and Time

Adjust date and time settings. First enter the menu option and set the date with the key pad. The date is formatted as: DD-MM-YYYY. After setting the date, confirm with enter and then enter the time settings in format: HH:MM:SS, again confirm with enter. The new date will become active immediately.

Date/time settings are kept actual by the real time clock until long power down. Date and time will also be synchronized with the computer when used with VPStudio. Pressing the store button will trigger the synchronisation.

1.4 Modbus address

The Modbus address can be changed with this option. Use the up and down buttons to change the number. Available numbers 1 - 247.

After setting the number press enter to save the address. The power of the VPFlowScope DP needs to be cycled to activate the new address.

1.5 Display dim time

The display backlight dim time can be adjusted here. The default dim time is set to 10 seconds. Other Available options are:

- Fading off. The backlight will remain on.
- 5 till 30 seconds with steps of 5 seconds.

Confirming with menu will make this setting immediately active.

1.6 Display orientation

The text on the display can be set upside down for installations were the VPFlowScope DP is installed in this way. Enter the menu item and select the desired orientation with the arrow keys. Confirm with enter to make these settings active.

All keys will maintain their function.

2 DAQ Sessions

The VPFlowScope DP contains an optional 2 Million point data logger. When available, the menu is set to start and stop the sessions or to delete all present data.

2.1 Start session

The session will be started when you push the enter button after selecting this option. When the session is started, the menu will close and the main screen will be shown. A blinking dot in the right upper corner will indicate the running session. The menu will be blocked when a session is active. The session can be stopped by pressing the esc button.

2.2 Delete all

All sessions will be deleted. It is not possible to delete just a single session.

3 Advanced

3.1 Reset

Reset the device. All peripherals will be reinitialized. This option is also needed when updating the display firmware.

8 VPStudio software

The VPFlowScope DP can be read out and configured with the VPStudio software. This software can be downloaded from www.vpinstruments.com/downloads.

In case of basic configuration and read out, use the free edition. If real time data viewing and recording is required, request a license code by our sales department.

A quick start is shown below, read the VPStudio manual for more information. This manual can be downloaded from www.vpinstruments.com/downloads



The sensor module needs to be connected to the display in order to read out the display. It is not possible to read out sessions when the VPFlowScope DP sensor is not connected

Connect the VPFlowScope DP to the computer

The VPFlowScope probe can be connected to the computer with the M12 connector through the JB5 interface box. This interface box combines the power and data signals. Power up the device by connecting the 24VDC power supply to the JB5 interface box. A RS485 to USB converter can be used to connect the JB5 interface box to the computer.

Install USB converter driver

A driver needs to be installed for the RS485 to USB converter. The driver might be installed automatically by your windows system or need to be installed manually. All drivers are available on our website www.vpinstruments.com/downloads.

Configure the VPFlowScope DP

- · Start the VPStudio software
- In the explorer window, right click to open the menu. Now click add device
- Click the scan button to search for the right COM port. Select it and click add
- Enter a name for the device
- Now select serial for RS485 converter
- Set the communication parameters if available
- · Click add

VPFlowScope DP sensor read out

- Click on the device in the explorer window to read out the settings
- The status tab provides general information
- The installation tab is used to configure the settings

VPFlowScope display read out

- Click on the plus icon to unfold the display icon
- Click on display to read out the display settings
- The status tab provides general information
- The installation tab is used to configure the settings
- Click sessions below display to retrieve session data

9 Electrical connections




NEVER USE AC POWER. THIS WILL VOID WARRANTY AND BRING PERMANENT DAMAGE TO THE ELECTRONICS. THE INSTRUMENT MIGHT BE DAMAGED BEYOND REPAIR.

CONNECT THE M12 CONNECTOR BEFORE POWERING UP THE INSTRUMENTS.

The VPFlowScope DP provides a 4..20 mA / pulse output and a Modbus output. All signals are present in the M12 connector. These outputs can be used to connect the VPFlowScope DP to a building management system or energy monitoring system like VPVision.

Pin	Signal	Wire color*
1	+1224 VDC	Brown
2	0 Volt	White
3	420 mA signal, active	Blue
4	RS485 A	Grey
5	RS485 B	Black

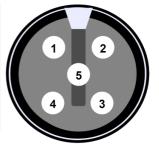

M12 5-pin female connector

Cabling

Shielded twisted pair cabling must be used for proper communication and measurement. Connect shield to safety ground on one point. The thickness of the wires depends on the cable length. For cabling below 300 meter | 1000 ft, use 20 awg. For longer runs use 18 awg or better.

Power supply

The input voltage is 12 to 24VDC. Make sure that the power supply is at least 12V at the connector. Voltage drops will occur in long cables resulting in insufficient power. The display will notify you when there is insufficient power.

9.1 4..20mA output

The 4..20mA output is an active, non- isolated linearized current loop that can be used to connect the VPFlowScope DP to a control system, a building/process management system or any 4..20 mA based system.

There is one 4..20 mA output available on the VPFlowScope DP. This output can be assigned to one of the measurement parameters, only one can be selected. For each measurand, a number of units is available. The factory default is m_n /sec.

Measurand	Unit
Flow	m _n /sec
Flow	m ³ _n /hr
Flow	I _n /min
Flow	SCFM
Flow	m ³ _n /min
Flow	sfps
Pressure	bar
Pressure	psi
Temperature	°C
Temperature	°F

^{*} Wire colors for standard VPInstruments cables

For scaling purposes, the zero and span matching 4 and 20mA can be modified. This will not effect the original measurement range. The zero and span are only used to increase or narrow the resolution. For bi-directional measurement, the zero value needs to be set negative. See below table for factory defaults.


Mode	Zero	Span	Idle output
Single direction	0% flow range	100% flow range	4 mA
Bi directional	-100% flow range	100% flow range	12 mA

Configuration with VPStudio


VPStudio can be used to configure the 4..20mA settings. Use the select box to choose the preferred unit that will be assigned to the output. Set zero and span to the preferred values.

Changing to volumetric units, the programmed diameter is calculated in the settings. So change the diameter first, then the analogue settings. VPStudio provides feedback while you are changing the settings. Use "set default" to go back to the factory default.



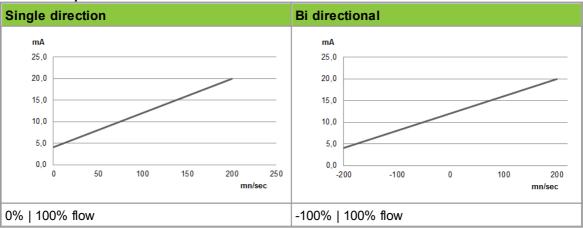

Electrical scheme:

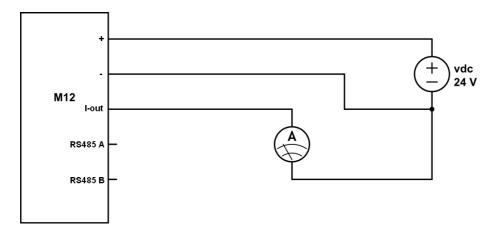

The current meter is placed in between the current output and the power supply ground. You can also use a digital multimeter to test the current output.

9.2 Pulse output

The VPFlowScope DP features a low-frequency active pulse output. The pulse is a 'non potential' free output as it acts like a controlled current output. To make it passive, an external isolator can be used.


The pulse interval can be set with the VPStudio software. A pulse from 0..20 mA will be generated when the interval exceeds. The maximum pulse frequency is once per 2 seconds. If the pulse interval is set too small, a continuous pulse (20mA high level) will be the result.

The pulse output is connected to the internal totalizer value. When the totalizer has increased by the pulse interval, the pulse will be generated. As it is not possible to generate a negative pulse, negative flow can not be indicated by pulse. In case of negative flow, the internal totalizer will count backwards. Pulses will not be generated until the same amount of positive flow has been added to the totalizer again. In this way we ensure that the pulse output will always be synchronized with the internal totalizer of the VPFlowScope DP. In case of continuous negative flow, consider to swap the flow meter direction.


Default settings

20 id art 50 tarings				
Diameter	Diameter	Pulse interval		
> 40 mm and < 92 mm	> 1.57 inch and < 3.62 inch	1 m ³ _n		
> 92 mm and < 160 mm	> 3.62 inch and < 6.3 inch	2 m ³ _n		
> 160 mm and < 205 mm	> 6.3 inch and < 8.07 inch	5 m ³ _n		

Pulse output

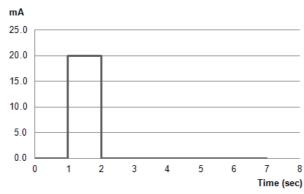

Electrical scheme:

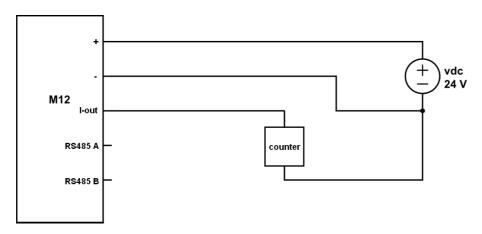

9.3 Modbus interface

Introduction to Modbus

For a complete introduction on the Modbus standard can be found on www.modbus.org. See the document Modbus_over_serial_line_V1_02.pdf, which can be downloaded from their website. We strongly recommend to download and read this information carefully before installing Modbus communication. The following paragraphs in this chapter assume you are familiar with the Modbus communication standard.

All measurement parameters are available through Modbus in floating point and integer format. The data will be refreshed every second. Maximum polling interval is 10ms.

Communication settings

The RS485 communication settings can be changed with VPStudio. Below shows the available options

• Baud rate: 9600 | 19200 | 38400

• Stop bits: 1 | 2

• Parity: None | Even | Odd

The Modbus settings can be changed with VPStudio, the hardware address can also be changed with the keypad when available. Below shows all available options

Hardware address: 1-247Integer multiplier: 1-1000

Data format

Function code 0x03 for reading(Holding register) Function code 0x10 for writing (Holding register) 32-bit Floating point Little endian 32-bit signed Integer Little endian

Register map

The actual measurement data is placed in holding registers. To read out data, you will need to use the corresponding holding register. All data is stored in 2 16-bit registers with below register number as start address. Read out the data with this start address and length 2.

Decimal	HEX	Description	Туре	Read / Write
16	0x10	Flow in m _n /sec	32-bit integer (x10)	Read
17	0x11	Flow in m ³ _n /hr	32-bit integer (x10)	Read
18	0x12	Flow in I _n /min	32-bit integer (x10)	Read
19	0x13	Flow in SCFM	32-bit integer (x10)	Read
20	0x14	Flow in m ³ _n /min	32-bit integer (x10)	Read
21	0x15	Flow in sfps	32-bit integer (x10)	Read
32	0x20	Pressure in bar	32-bit integer (x10)	Read
33	0x21	Pressure in psi	32-bit integer (x10)	Read
64	0x40	Temperature in °C	32-bit integer (x10)	Read
65	0x41	Temperature in °F	32-bit integer (x10)	Read
128	0x80	Totalizer in m ³ _n	32-bit integer (x10)	Read / Write*

^{*} Writing to the totalizer will reset the totalizer to zero.

Decimal	HEX	Description	Туре	Read / Write
8	0x08	Diameter	32-bit Floating point	Read / Write
9	0x09	420mA Max	32-bit Floating point	Read / Write
10	0x0A	420mA Min	32-bit Floating point	Read / Write
11	0x0B	420mA Unit	32-bit Floating point	Read / Write
24	0x18	Flow in m _n /sec	32-bit Floating point	Read
25	0x19	Flow in m ³ _n /hr	32-bit Floating point	Read
26	0x1A	Flow in I _n /min	32-bit Floating point	Read
27	0x1B	Flow in SCFM 32-bit Floating po		Read
28	0x1C	Flow in m ³ _n /min	32-bit Floating point	Read
29	0x1D	Flow in sfps	32-bit Floating point	Read
40	0x28	Pressure in bar	32-bit Floating point	Read
41	0x29	Pressure in psi	32-bit Floating point	Read
72	0x48	Temperature in °C	32-bit Floating point	Read
73	0x49	Temperature in °F	32-bit Floating point	Read
136	0x88	Totalizer in m ³ _n	32-bit Floating point	Read / Write*

^{*} Writing to the totalizer will reset the totalizer to zero.


Available write operations

Option	Data	Description
420mA unit	0 1 2 3 4 5 6 7 8 9 Other	m _n /sec m ³ _n /hr I _n /min SCFM m ³ _n /min sfps bar psi °C °F m _n /sec
420mA min	Decimal value	
420mA max	Decimal value	
Diameter	25 - 1016 mm	
Totalizer	Integer or floating point type depending on register type	Will reset the totalizer to zero



Installing a RS485 network require specific knowledge. Not following the specifications strictly might result in in-correct communications and equipment damage. Please leave installation up to professional contractors. Make sure that they read this chapter carefully and follow up all RS485 guidelines.

RS485 is a differential balanced line over twisted pair. It can span relatively large distances up to 1200 meter | 4000 feet. The wires should be connected as a point-to-point configuration, or also called daisy chain. Do not install as star or ring network! The trunk line goes from the master to all devices making a drop down to each device. The cable length from the trunk line to the Modbus device needs to be as small as possible. Junction boxes are used to make the T junction.

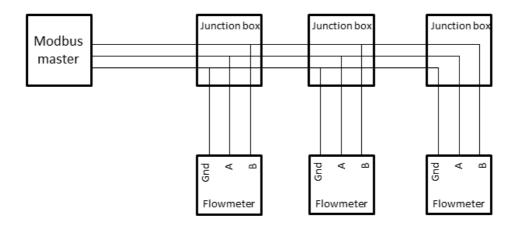

Shielded twisted pair should be used. Connection of a third wire between the master and slave should be done to limit the common mode voltage that can be impressed on the slaves inputs. The required cable quality depends on the total cable distance, the number of nodes and the environmental influences. A local contractor can help you select the right cable for your application.

Termination resistor

Termination resistors reduce electrical noise sensitivity. They need to be added to the installation when cable distances become longer then 10 meter. The value of each termination resistor should be equal to the cable characteristic impedance (typically, 120 ohms for twisted pairs).

There can only be one termination resistor at the very end of the trunk line. The VPInstruments junction box features a jumper that can be used to enable a 120 Ohm resistor. When using the VPInstruments Modbus Junction boxes make sure that the 120 Ohm resistor is only enabled in the last Modbus Junction box in the daisy chain.

Biasing


When there is no data activity on an RS485 network, the communications lines are "floating" and, thus susceptible to external noise or interference. Receivers on a RS485 network have built in hysteresis (200mV differential required to insure known state). To insure that a receiver stays in an inactive state, when no data signal is present, bias resistors are required. Bias resistors are a pull-up resistor on Modbus B and a pull-down resistor on the Modbus A line. The value of the bias resistor depends on the number of devices and the supply voltage. The table below shows which resistor values can be used for different voltage in a chain with 1 to 8 VPFlowScope DP's.

Supply voltage	Bias pull up	Bias pull down
12 V	5 ΚΩ	1 ΚΩ
24 V	10 ΚΩ	1 ΚΩ

Bus power

The VPFlowScope DP can be powered via the same trunk line. 2 separate wires are used for power + and power -. Take in account that long wires with multiple slaves will cause voltage drops. The minimum supply voltage is 12VDC measured at the last VPFlowScope DP in the daisy chain.

Electrical scheme

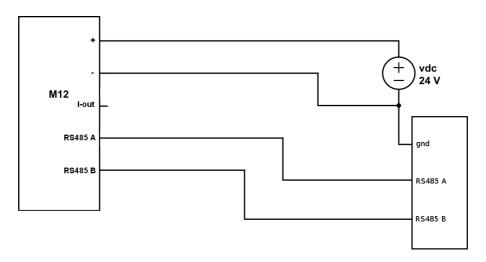

10 Service

The VPFlowScope DP needs regular maintenance to ensure that the product is functioning properly. Especially when the product is used for mobile air audits, we recommend inspecting the instrument before and after every audit to ensure that the product has not been damaged. For precision measurement equipment such as the VPFlowScope DP, a proper maintenance program is key to reliable measurement results and a long product lifetime.

10.1 Software and firmware updates

News on software and firmware updates can be found on www.vpinstruments.com, or are provided by your local re-seller. The VPFlowScope DP sensor can be updated via the RS485 port. A special display update cable is used for updating the firmware of the display. This cable is available on request. Do not use a standard cable as this might damage your display or computer. Instructions on the update procedure are distributed on request. Upgrading is only possible for authorized technicians, at own risk.

10.2 Recalibration

To keep your VPFlowScope DP in best shape, it needs recalibration. The recommended recalibration date can be found in VPStudio, when you read out your VPFlowScope DP. Keep close eye on this date. We advice annual recalibration.

10.3 Filter set replacement

Fixed installations:

We recommend to check the instruments 1 week, 4 weeks, 2 months, 4 months, 8, 1 2 months after the date of first installation, to check the rate of pollution on the probe and the internal filters.

Mobile use (Air Audits):

Please make sure that the probe is dried out completely after the audit. The probe can be separated from the transmitter, to check the condition of the filters, and to remove any condensate. We recommend to

do this after every audit.



Check the filter condition

- Filters white and dry: They are still clean, leave them in place.
- Filters brown and wet/ oily: replacement is required



- Use a pair of tweezers to remove the o-rings
- Remove the filters with the same tweezers. They are self-adhesive

Remove any glue remains with acetone.



- Place the new filters in the dedicated cavities.
- Make sure they are sticked on a clean, dry, grease-free surface
- Place the o-rings back, assemble the unit together and apply a pressure test to make sure all seals are tight.

DO NOT APPLY ANY GREASE TO THE O-RINGS.

10.4 Service subscriptions

VPInstruments offers several Service Subscriptions. Enrolling in a Service Subscription helps you get the most out of your measurement equipment. We keep your equipment in excellent and most reliable condition, as we include annual re-calibration on our calibration equipment. With the latest software releases and expert technical support, you will save time and money. We offer the following programs:

- Standard Service Agreement; Cleaning. Re-calibration, repair*, firmware update(s) and warranty extension when serviced within 12 months subsequent intervals.
- Service Exchange Agreement; Annual exchange of your flow meter. No service time! Have a fully calibrated flow meter 24/7, 365 days a week!
- * Repair within terms of usage, see general terms and conditions.

The VPInstruments service subscriptions helps keeping you focused on what matters most for your company.

Benefits

- Annual calibrated and cleaned instruments
- Warranty extension
- Software- and firmware updates
- Personal (phone) support and e-mail support by our skilled technicians

Consult your distributor for the best VPInstruments service agreement for your business.

Specifications 11



Please always check the label of your product for the specifications.

Specifications are subject to change as we are continuously improving our products. Please contact us to obtain the latest specification sheet.

Flow sensor

(minimum detection level and max flow rate shown)

Flow range 20...200 mn/sec 65...650 sfps

2% of reading under calibration conditions Accuracy

Recommended pipe diameter: 50mm | 2 inch and up

Reference conditions 0°C, 1013.25 mbar - DIN1343 32°F, 14.65 psi

Gas temperature -40....150°C -40..302°F lcing should be

avoided

Gases Compressed air, non aggressive gasses and non combustible

gasses, 95% non condensing gases

Pressure sensor

Range 0...16 bar gauge 0...250 psi gauge

Accuracy +/- 1.5% FSS (0...60°C) +/- 1.5% FSS (32..140°F)

Temperature sensor

-40....150°C -40...302°F Range

Accuracy +/- 1°

Display

Technology Liquid crystal

Back light Blue with auto power save Memory 2.000.000 point memory

Mechanical

Probe length 400 mm 15.7 inch Probe diameter 12.7 mm 0.5 inch Process connection Compression fittings, 0.5 inch, NPT thread IP grade

IP52 when mated to display module

IP63 when mated to connector cap

Wetted materials Alu, SS316, epoxy

32 .. 140°F Ambient temperature 0..60°C

10 - 95%. Avoid condensation at all Ambient humidity

times

Inputs and outputs

Analog 4..20mA or pulse, selectable via installation software

Serial IO Modbus RTU

Supply 12..24 VDC +-10% CLASS 2 (UL)

150mA at 24VDC Power consumption

12 Order information and accessories

The VPFlowScope DP is available in 1 length (400 mm) only. You can choose some options:

Order Code	Flow range	Option	Length	Option	Display
VPS.R200	20 to 200 mn/sec	P4DP	400 mm length	D0	No display, No connector cap
				D10	Display
				D11	Display + 2M point logger
				D2	Connector cap

Basic features	Display features	Connector types
Thermabridge Flow sensor	3 line display	M12, 5 pin for standard
Pressure, temperature sensor	Keypad for configuration	application
420mA / pulse output (switchable)	Multi session data logger	
RS485 Modbus RTU		
Calibration report		

Accessories

VPA.5000.005	Cable, 5m / 16.4 ft with M12 5pin connector on one side, open wires on other side
VPA.5000.010	Cable, 10m / 32.9 ft with M12 5pin connector on one side, open wires on other side
VPA.0000.200	Power supply (12V, 5pin)
VPA.5003.000	RS485 to USB converter
VPA.5001.205	JB5 interface kit with 5m / 16.4ft cable + 24 VDC power supply + RS485 to USB
	converter

VPStudio software

SFT.5003.100 Free edition SFT.5003.300 Licensed edition

13 Appendix A - UL

The VPFlowScope complies with the CE requirements as stated in the CE declaration. CE compliance can only be achieved when grounding and shielding directions are followed and proper cables and connector assemblies are used.



Electrical connection guidelines- UL 508 Listing for USA & Canada (Check label to see if product is UL marked)

The VPFlowScope is intended to be used with a Class 2 power source or Class 2 transformer in accordance with UL1310 or UL1585. As an alternative a LVLC (Low Voltage Limited Current) power source, with the following properties can be used:

- The device shall be used with a suitable isolating source such that the maximum open circuit voltage
 potential available? to the product is not more than 24 V DC and the current is limited to a value not
 exceeding 8 amperes measured after 1 minute of operation;
- A fuse in accordance with the UL248 series and rated max 4A, shall be installed in the 24V DC power supply to the device? In order to limit the available current.

Electrical connection guidelines: general remarks

Make sure that the following conditions are met:

• For portable, non-critical applications, a switched mode 12 VDC, 1A power adapter may be used. Switched mode power supplies that are of poor quality, might affect the accuracy.

Le VPFlowscope est conforme aux exigences CE, comme indiqué dans la déclaration CE. La conformité CE ne peut être atteinte que lorsque les directives de mise à la terre et d'isolation sont suivies et que les les câbles et raccords appropriés sont utilisés.



Lignes directrices pour branchements électriques – UL508 pour le Canada et les États-Unis (voir sur l'étiquettesi le produit est marqué UL)

Le *VPFlowscope* est prévu pour être utilisé avec une source d'alimentation Classe 2 ou avec un transformateur de Classe 2 en accord avec UL1310 ou UL1585. Comme alternative, une source d'alimentation BTCL (Basse Tension Courant Limité) avec les propriétés suivante peut être utilisée :

- Le dispositif doit être utilisé avec une source d'isolation appropriée afin que le voltage maximal en circuit ouvert disponible pour le produit ne dépasse pas 24VDC, et que le courant soit limité à une valeur de 8 ampères après 1 minute de fonctionnement.
- Un fusible de 4A maximum, et conforme à la série UL248 doit être installé dans la source d'alimentation de l'appareil afin de limiter le courant disponible.

Directives pour le raccordement électrique : remarques générales

Assurez-vous que les conditions suivantes sont remplies :

• Pour les applications mobiles, un adapteur de type alimentation à découpage 12VDC, 1A peut-être utilisée. Cependant, un adapteur de mauvaise qualité pourra affecter la précision.

Notes

EASY INSIGHT IN ENERGY FLOWS

VPInstruments

Buitenwatersloot 335 2614 GS Delft The Netherlands info@vpinstruments.com www.vpinstruments.com

MAN-VP-SDP-UK-1700 Date: 19-01-2017

